



Issuing Entity:
Larson International Inc.
P.O. Box 638
Plainview, TX 79073-0638
U.S.A.
Phone 806-293-1353
Fax 806-293-5215
www.larsonintl.com

Bulletin No.: L16-002
Release Date: 3/16/16
Effective Date: Immediately
Supersedes: N/A
Completion Date: N/A
Page: 1 of 2

SERVICE BULLETIN


Ride Manufacturer: Larson International Inc. **Affected Production Dates:** All
Ride Name: FLYING SCOOTERS **Affected Serial Nos.:** 7-25

Abstract Of Issue: Inspection of the sweep assembly vertical tubes (L340000 item 1).

Reason for Release: Cracks have been found in these locations. These specific areas need to be examined during your daily and annual inspections.

Action To Be Taken: Visually inspect the vertical tubes of all sweeps for cracks. Any visual indications shall also have NDT MT performed to determine the crack length. Contact Larson International to determine if the sweep can be repaired. Add this service bulletin to the ride manual as detail for the daily inspection and add an annual NDT MT inspection of these areas.

Detail Of Issue:

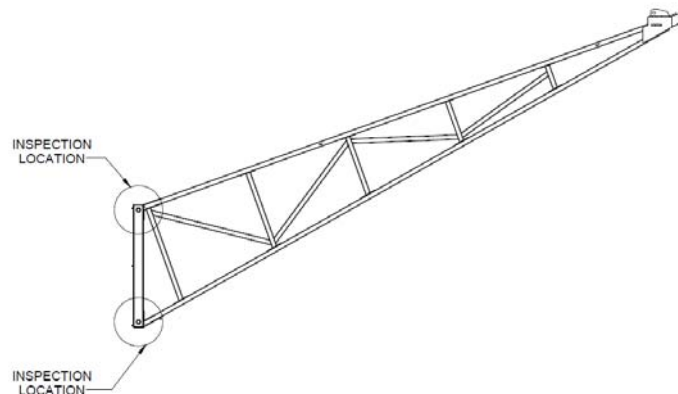

Larson International Inc. issues notifications for the benefit of owners of amusement rides manufactured by Larson International, Inc. As a service to the industry, and in the interest of employee and public safety, Larson International, Inc. also issues notifications for the benefit of owners of amusement ride equipment for which the manufacturer no longer exists such as LMC, Inc. and Hi-Roller Company. In doing so, Larson International, Inc. does not assume liability for losses associated with amusement ride equipment built by manufacturers other than Larson International, Inc.

